

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic, Import Vehicles

CAMPAIGN No.	GAI 3786	DATE	27.Mar.2024
MANUFACTURE	BMW (Japanese Importer)		
DESCRIPTION OF DEFECT	A hose clip on the fuel hose (quick-release coupling to fuel pump) may be insufficiently crimped. During the starting operation, a higher pressure occurs in the fuel system than when driving. Due to this increased fuel pressure during the starting operation, the fuel hose can move on the quick-release coupling and may slip off completely over time. As a result, small quantities of fuel can leak out under the parked vehicle and the engine cannot be started.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
8BL-K16AA	K1600GT	2022 - 2024	96
8BL-K16AA	K1600GTL	2022 - 2024	102
8BL-K16AA	K1600B	2022 - 2024	34
TOTAL			232