

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-3829	DATE	September 9, 2024
MANUFACTURE	Aston Martin Lagonda Limited (Japanese Importer : Aston Martin Japan Limited)		
DESCRIPTION OF DEFECT	In some engine oil cooler hoses, due to improper manufacturing processes, the inner wall of the hose is unevenly thick due to the formation of small indentations, etc. If the thin inner wall of the hose is subjected to the hydraulic pressure (approx. 7.85 bar) generated during engine operation, the hose will rupture and leak oil from around this area, causing the warning light to illuminate. In the worst case, the leaked oil could get into hot parts and cause a fire.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
7BA-AM801	DBX707	2022-2023	155
		TOTAL	155