

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIN No.	Gai – 3922	DATE	27 Dec, 2024
MANUFACTURER	Rolls-Royce Motor Cars Limited. (Japanese Importer : BMW Group Japan)		
DESCRIPTION OF DEFECT	In an integrated brake unit, foreign matter is attached to the motor sensor circuit board because manufacturing management is inappropriate. Also, since design studies on contact pin length are insufficient, noise is generated due to contact pressure with the motor sensor circuit board. Therefore, poor electrical contact occurs, and a brake warning light is turned on and a check control message is displayed. If driving continues as it is, stronger stepping force than normal is required during brake operation due to falling back mode, and there is a risk that the engine will not be able to start next time.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ZAA-TK2293	SPECTRE	2024	74
		Total	74