VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-3982	DATE	14 th April, 2025	
MANUFACTURE	Aston Martin Lagonda Limited (Japanese Importer : Aston Martin Japan Limited)			
DESCRIPTION OF DEFECT	In some engine oil cooler hoses, due to improper manufacturing processes, small indentations and other irregularities may form on the inner wall of the hose, resulting in uneven wall thickness.			
	As a result, when oil pressure generated during engine operation is applied to the thinner areas of the hose wall, the hose may rupture, causing oil to leak and the warning light to illuminate. In the worst-case scenario, the leaked oil could come into contact with high-temperature areas of the engine, posing a risk of fire.			

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
	DB12	2023-2024	113
7BA-AM801	DBX707	2023-2024	93
		TOTAL	206