

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Import Vehicles

CAMPAIGN No.	Gai-4146	DATE	9 th Feb, 2026
MANUFACTURER	BMW (Japanese Importer: BMW Group Japan Corp.)		
DESCRIPTION OF DEFECT	Due to an improper manufacturing process, some of the bolts fastening the upper oil pan to the crankcase are not tightened to the specified torque. As a result, the bolts can loosen due to vibrations during driving and fall into the lower oil pan, damaging the oil pump chain and causing an insufficient oil supply to the engine, resulting in the display of check control message, accelerated wear on the connecting rod bearings and main bearings, and the generation of abnormal noise. If the vehicle continues to be driven in this condition, it could lead to a decrease in compression function due to the connecting rod, abnormal rotation of the crankshaft, misfires, and in the worst case scenario, the engine could stall while driving.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
3LA-82FK44	BMW M5	2024	1
		Total	1