

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic/Import Vehicles

RECALL No.	Gai-3923	DATE	Feb. 6. 2026
MANUFACTURER	Ford Motor Company		
DESCRIPTION OF DEFECT	<p>SAFETY RECALL: Exterior A-Pillar Applique Molding Inspection</p> <p>In some of the affected vehicles it may be possible that some of the exterior A-pillar applique trim clip attachments are not properly engaged due to improper assembly or repair. If this occurs, the A-pillar applique trim may be loose, missing or may become detached. An exterior A-pillar trim part that detaches while driving can create a road hazard for other road users, increasing the risk of a crash.</p> <p>Dealers are to: Inspect both left hand (LH) and right hand (RH) exterior A-pillar applique moldings. As needed, per inspection results, replace A-pillar applique molding(s) including adding adhesive. This service must be performed on all affected vehicles at no charge to the vehicle owner.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
ABA-1FMHK8	Explorer 3.5L AWD	2011 - 2015	2895
ABA-1FMHK9	Explorer 2.0L FWD	2011 - 2015	3247
ABA-1FM5K8	Explorer 3.5L AWD	2016	266
ABA-1FM5KH	Explorer 2.3L FWD	2016	729
ABA-1FM5KT	Explorer 3.5L Turbo AWD	2016	237
TOTAL			7374