

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Import Vehicles

CAMPAIGN No.	GAI-4194	DATE	May. 28. 2026
MANUFACTURER	HONDA DVLPMT. & MFG. OF AMERICA, LLC		
DESCRIPTION OF DEFECT	In the low pressure fuel pump installed in models that require premium unleaded fuel, the use of an inappropriate test fluid in pump operation testing may allow the test fluid to penetrate the impeller (plastic impeller), resulting in reduced strength and cracks. For this reason, cracks in the impeller may propagate due to repeated thermal cycling and swell when exposed to fuel, causing contact with the pump cover and resulting in malfunction. In the worst-case scenario, the engine may stop while driving and may not restart.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
CAA-NC1	「NSX」	2018～2019	235
5AA-NC1		2019～2022	55
		TOTAL	290

The affected parts shipped as repair parts, but the vehicles with them installed, cannot be identified.

PARTS	PART No.	DELIVERED AS “SERVICE PARTS”	NUMBER OF PARTS
MODULE ASSY., FUEL PUMP	17045-T6N-X02	2020～2026	58
	17045-T6N-X01	2018	1
TOTAL			59