

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	5213	DATE	26 Sep , 2022
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	Wrong transistors are installed to the turn signal electrical circuits of the rear combination lamps on some shovel loaders. Those transistors may be melted by the heat generated in the electrical circuits when the turn signal is turned on, and as a result high flasher may occur. In addition, the capacitors in the turn signal electrical circuits have insufficient capacity on some machines. If the charge in those capacitors decreases due to voltage fluctuation during operation, the power consumed in the circuits may decrease below the threshold value of high flasher. If the turn signal or hazard lights are turned on under the above condition, high flasher occurs.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDS-WA142	WA470-10	2019-2022	30
		TOTAL	30