

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5255	DATE	December. 8. 2022
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>(1) In generators, the height of the rib inside the left crank case cover where a stator coil is mounted is improperly set, potentially causing the coil wire to interfere with the rib and be damaged, which may lead to shorting. This will cause the battery to weaken and, if continued to be used unaddressed, cause the engine to stall while driving and be unable to be restarted.</p> <p>(2) In emergency vehicles, the jig used for painting the threaded portion of the ground nut on the body side was improperly selected, causing some of the ground nuts to have paint on the threaded portion. This causes an oxide film to form between the ground nut and ground bolt, increasing electric resistance and leading to conduction failure. As a result, the warning light, siren, and radio equipment may fail to operate properly.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
8BL-SC54	「CB1300 SUPER FOUR」 「CB1300 SUPER BOLD'OR」	2021~2022	1,537	(1)1,537
8BL- SC62	「CB1300P」	2020~2021	518	(1)518 (2)439
			TOTAL	(1)2,055 (2)439