

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5342	DATE	June 15, 2023
MANUFACTURER	Mazda Motor Corporation		
DESCRIPTION OF DEFECT	<p>[1] On the front suspension, due to improper vehicle assembly process, upper arm ball joint and steering knuckle fasten bolt and nut may not tightened to appropriate torque. As a result, the bolt may come off during the usage. In the worst case, steering knuckle come off from ball joint and contact with the tire, causing a flat tire makes vehicle unable to drive.</p> <p>[2] On the Intermediate shaft, due to improper vehicle assembly process, steering gear fasten bolt may not tightened to appropriate torque. As a result, the bolt may come off during the usage. In the worst case, intermediate shaft come off from steering gear, causing unsteerable.</p> <p>[3] On the front ABS sensor, due to improper vehicle assembly process, the bolt that secure the bracket that holds the harness to steering knuckle may not tightened to appropriate torque. As a result, the bolt may come off during the usage. In the worst case, the harness getting damage and ABS, TCS/DSC warning light may come on and EPB indicator light flashing. In addition, those functions and advanced safety driving support system may not work.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
3DA-KH3P	Mazda 「CX-60」	2022	[1] 729
			[2] 729
5BA-KH5P			[3] 729
			[1] 24
			[2] 24
			[3] 24
		Total	753