

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5346	DATE	.Jul.6 2023
MUNUFACTURER	Mitsubishi Fuso Truck and Bus Corporation		
DESCRIPTION OF DEFECT	<p>On some large-sized route buses, the wiring harness interferes with the upper rear edge of the air conditioner control unit, inside the power distribution box installed on the upper right side of the driver's seat, due to insufficient design consideration and instructions to the assembly department. If the bus continues to be used in this condition, the vehicle vibration may damage the interfering wiring harness, causing electrical component malfunction or short-circuiting of wiring. In the worst case, a fire will occur.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
KC-MP317K	「FUSO AERO STAR」	1999~1999	3
KC-MP717M		1998~1998	15
KC-MP747K		1998~1999	17
KC-MP747M		1998~2000	7
KL-MP35JK		2000~2002	24
KL-MP35JM		2004	1
KL-MP37JK		2003~2003	13
KL-MP37JM		2000~2007	42
PJ-MP35JK		2006~2006	4
PJ-MP35JM		2006	1
PJ-MP37JK		2006~2007	14
PJ-MP37JM		2006~2006	11
PKG-MP35UK		2009~2009	22
PKG-MP35UM		2008~2010	60
LKG-MP35FM		2011~2012	23
LKG-MP35FP		2011~2011	2
LKG-MP37FK		2011~2012	3
LKG-MP37FM		2010~2012	22
QDG-MP35FM		2012~2015	28
QDG-MP35FP		2012~2014	37
QKG-MP35FK		2012~2014	23
QKG-MP35FM		2012~2014	128
QKG-MP35FP		2012~2014	82
QKG-MP37FK		2012~2014	365
QKG-MP37FM		2012~2015	99
LKG-AP37FM	「SPACERUNNER A」	2010~2010	5
		TOTAL	1,051