

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5 3 5 0	DATE	Jul.14.2023
MANUFACTURER	N I S S A N、N I S S A N M T		
DESCRIPTION OF DEFECT	In the blow-by hose that leads the blow-by gas of the power generation engine to the intake pipe, the dimensions of the protector that prevent deterioration of the hose surface are insufficient due to inadequate evaluation at the time of development. Therefore, cracks occur on the hose surface of the part not covered by the protector in terms of use, and in the worst case, the engine may not start, and the motor may stop during the driving and the vehicle may not be driven.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
DAA-HE12	NOTE	2016~2020	289,827
DAA-SNE12		2018~2020	25,085
DAA-HC27 6AA-HC27	SERENA	2018~2020	15,192
DAA-HFC27 6AA-HFC27		2017~2021	87,731
6AA-P15	KICKS	2020~2022	66,190
		TOTAL	484,025