

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5394	DATE	Oct.19 2023
MUNUFACTURER	Mitsubishi Fuso Truck and Bus Corporation		
DESCRIPTION OF DEFECT	<p>On some large-sized route buses, the connector terminals of the electric water pump for cooling the urea injection unit are improperly arranged. The water pump does not operate when the DPF is hot immediately after engine shutdown, causing the urea valve in the urea injection unit to melt down because it is not cooled. If the vehicle continues to be used in this condition, urea water will leak out, and in the worst case, the exhaust gas purification process may not be performed properly.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2KG-MP35FK	「FUSO AERO STAR」	2023	1
2KG-MP35FM		2022~2023	5
2KG-MP35FP		2022~2023	7
2KG-MP38FK		2022~2023	5
2PG-MP35FM		2022~2023	35
2PG-MP35FP		2022~2023	8
2PG-MP38FK		2022~2023	185
2PG-MP38FM		2022~2023	14
			TOTAL