

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5410	DATE	November. 9. 2023
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>(1) Some rear stop switches are not durable enough due to inappropriate combination of waterproof grommet materials. Because of this, if the said grommet cracks due to ozone degradation and rainwater, etc. penetrates into the switch from the crack and attaches to the contact part of the switch, which may turn on the brake lamps although the brake pedal is not hit. In the worst-case scenario, the brake lamps may not turn on even if the brake pedal is hit due to the poor electrical continuity of the switch's contact part.</p> <p>(2) Some of the device to stop the engine at the time of fall (bank angle sensor) are equipped with a sensor holder of which sealing performance is insufficient due to the inappropriate molding work and mold management of the said sensor holder. Because of this, if water penetrates into the sensor when riding in the rain, for example, the circuit board inside the sensor short-circuits and the sensor may erroneously detect it as a fall and stop the engine while the vehicle is still running.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	NOTE
2BL-NC59	「GB350」 「GB350 S」	2021~2022	17,151	(1)17, 151 (2)10, 303
			TOTAL	17,151