

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	5468	DATE	May 22, 2024	
MANUFACTURER	UD Trucks Corporation			
DESCRIPTION OF DEFECT	With regards to the vehicle which urea water tank is relocated, due to the inappropriate waterproofing of extension harness and connector, rainwater, etc., may enter the connector and corrode the terminals. Thus, if a continuity failure occurs at the connection terminals, communication between the engine control module and the aftertreatment control module attached to the urea water tank will be disrupted, the exhaust gas after-treatment system becomes inoperative and a warning message "Vehicle electrical control system abnormal" is displayed on the central display of the instrument cluster. If the vehicle continues to run as is, nitrogen oxide emissions in exhaust gas may exceed the standard value.			
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE	
2RG-CG5FA	Quon	2023	4	
2RG-CG5FE		2023	1	
2PG-CW5AL		2021	1	
2PG-CW5BL		2022	1	
2RG-CW5EL		2023	1	
2RG-CW5FL		2022	1	
2PG-GK5AAD		2022	1	
2PG-GK5AAE		2022	1	
		TOTAL	11	