

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5575	DATE	2024/11/29
MANUFACTURER	KUBOTA Corporation		
DESCRIPTION OF DEFECT	In the shovel loader of the service port specification (*), there is a possibility that the heater does not function because the heater harness of the blow-by gas circuit was connected to the coupler without power supply by mistake due to insufficient work instructions. Therefore, if the engine is continuously used, the engine blow-by gas pressure rises due to freezing and blockage of the blow-by gas circuit in a cold environment, the engine oil flows back, and in the worst case, the engine may overspeed and be damaged. *This specification equipped with piping that can supply hydraulic pressure to the hydraulic attachment etc, installed later by operating a lever on the driver's seat.		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
—	「R430E」	May 9, 2023 – January 11, 2024	4
—	「R530E」	December 18, 2023 – January 22, 2024	4
—	「R630E」	December 22, 2023 – December 27, 2023	2
		TOTAL	10

[Notes]

The range of vehicle numbers for recalled vehicles may include vehicles that are not.