Domestic Vehicles

CAMPAIGN No.	5592	DATE	December 5, 2024
MANUFACTURER	DAIHATSU		
DESCRIPTION OF DEFECT	In the front suspension, the paint adhesion to the steel of the coil spring is inadequate. As a result, if sand or small stones get caught in the spring, the paint layer can easily peel off, accelerating corrosion. Continuing to use it in this condition may lead the coil spring to break, which could potentially result in a tire puncture and make the vehicle unable to drive.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-LA800S 5BA-LA800S	MOVE CANBUS	2016-2018	140,181
DBA-LA810S 5BA-LA810S			27,613
EBD-S321V HBD-S321V	HIJET	2016-2017	12,309
EBD-S331V HBD-S331V			7,326
EBD-S321W	HIJET DECKVAN		308
EBD-S331W			490
EBD-S321B HBD-S321B	SAMBAR		891
EBD-S331B HBD-S331B			879
EBD-S321Q			8
EBD-S331Q	SAMBAR OPENDECK		10
EBD-S321M HBD-S321M	PIXIS VAN		1,006
EBD-S331M HBD-S331M			727
p		TOTAL	191,748