VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5594	DATE	December. 5. 2024	
MANUFACTURER	HONDA MOTOR CO., LTD.			
DESCRIPTION OF DEFECT	As for the high-voltage battery cable, due to the inappropriate finishing of the cable connector terminal surface and an inappropriate load on the spring supporting the connector, the terminal may slide and become worn out as the vehicle traveling on an uneven surface scrape its bottom on the ground. If the vehicle continues to be used without fixing this problem, the terminal will be oxidized and increased resistance will interrupt conduction, activating the system warning light, which has the risk of making the vehicle undrivable eventually.			

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED		NUMBER OF VEHICLE
ZAD-EF14	「GYRO CANOPY e:」	2021~2024		614
ZAD-EF13	「GYRO e:」			239
			TOTAL	853