

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5613	DATE	January. 31. 2025
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>As for the exhaust gas recirculator (EGR) mounted on a naturally aspirated engine, due to the inappropriate quality of the EGR pipe flange and also the inappropriate EGR operation control program, repeating short-distance driving while the engine is as cold as the air temperature may cause water condensation on the said pipe flange and around the EGR valve opening, corroding those parts. For this reason, if the vehicle continues to be used as it is, the corroded pieces of the parts may be caught between the EGR valve and the valve sheet, and in the worst-case scenario, the engine may stop while the vehicle is moving, unable to restart.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
DBA-JF3	「N-BOX」 「N-BOX Custom」	2017～2019	327,215
DBA-JF4			53,863
6BA-JF3		2019～2023	511,892
6BA-JF4			81,994
6BA-JF5	「N-BOX」 「N-BOX CUSTOM」 「N-BOX JOY」	2023～2024	149,220
6BA-JF6			26,379
6BA-JH3	「N-WGN」 「N-WGN Custom」	2019～2024	473,700
6BA-JH4			35,478
HBD-JJ1	「N-VAN」	2018～2021	57,919
HBD-JJ2			23,201
5BD-JJ1		2021～2024	59,961
5BD-JJ2			21,907
6BA-JG3	「N-ONE」	2020～2024	40,578
6BA-JG4			7,130
		TOTAL	1, 556,855

The affected parts shipped as repair parts, but the vehicles with them installed, cannot be identified.

PARTS	PART No.	DELIVERED AS "SERVICE PARTS"	NUMBER OF PARTS
PIPE COMP.A, EGR	18717-5Z1-000	2024	35
		TOTAL	35