

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	5724	DATE	October 17, 2025
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	In some hydraulic oil tank breathers of shovel loaders, the dimensions of the groove that secures the cover to the case were inadequately controlled. Consequently, gaps have occurred between the bayonet (resin) of the case and the bayonet (aluminum) of the cover. Additionally, due to insufficient consideration of the O-ring dimensions, there are cases where the compression allowance is too small. As a result, the O-ring cannot sufficiently fill the gap. If the bayonet continues to be used as it is, hydraulic oil may leak due to internal pressure in the hydraulic oil tank.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDN-WA139	「WA80-8」	2023~2024	172
YDP-WA138	「WA100-8」	2023~2024	668
YDP-WA138	「WA150-8」	2023~2024	173
YDR-WA137	「WA200-8」	2023~2024	235
YDP-WR005	「WR12-8」	2024	1
TOTAL			1269

Models of vehicles that may be used as service parts

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDN-WA139	「WA80-8」	2019-2023	9
W108	「WA100-5」	2003-2004	2
SB-W108	「WA100-5」	2005- 2010	19
KDP-WA115	「WA100-6」	2010- 2014	45
WDP-WA124	「WA100-7」	2014- 2017	30
YDP-WA138	「WA100-8」	2018- 2022	77
SB-W108	「WA150-5」	2004- 2010	12
KDP-WA115	「WA150-6」	2010- 2014	18
YDP-WA138	「WA150-8」	2020- 2022	14
EDR-WA105	「WA200-6」	2009- 2013	9
WDR-WA126	「WA200-7」	2014- 2016	4
YDR-WA137	「WA200-8」	2019- 2022	5

SC-W104	「WA270-5」	2004-2005	2
EDR-WA103	「WA270-6」	2007- 2013	6
SC-W105	「WA320-5」	2005-2007	3
EDR-WA108	「WA320-6」	2008- 2013	10
TOTAL			265