

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5728	DATE	2025/10/31
MANUFACTURER	KUBOTA Corporation		
DESCRIPTION OF DEFECT	<p>In the holder attached to the steering controller of the agricultural tractor, the design is insufficient to prevent water ingress, which can lead to water entering the inside of the holder and causing rust to develop on the splines connecting the shaft and the steering controller in the holder.</p> <p>Additionally, the design is insufficient to prevent vibration wear, which, along with rust, leads to wear on the splines.</p> <p>Therefore, if usage continues as is, the wear on the splines may progress, and in the worst case, the steering may become free-spinning, making steering operation impossible.</p>		
TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
YDP-MWS	「M860W—SE」	2018～2025	415
	「GVE860」		5
YDR-MWS	「M1010W—SE」	2018～2025	401
	「GVE1010」		5
YDR-MWX	「M1060W」	2016～2025	579
		TOTAL	1405