

VEHICLE SAFETY/ POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicle

CAMPAIGN No.	5764	DATE	January 14, 2026
MANUFACTURER	Komatsu Ltd.		
DESCRIPTION OF DEFECT	Some hydraulic oil tank breathers for shovel loader replacement parts have gaps between the case bayonet (resin) and the cover bayonet (aluminum) due to inadequate groove dimension control. Additionally, due to insufficient consideration of the O-ring dimensions, there are cases where the compression allowance is too small. As a result, the O-ring cannot sufficiently fill the gap. If the bayonet continues to be used as it is, hydraulic oil may leak due to internal pressure in the hydraulic oil tank.		

Models of vehicles that may be used as service parts

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
KDP-WA115	「WA100-6」	2011-2012	3
WDP-WA124	「WA100-7」	2017	1
YDP-WA138	「WA100-8」	2019- 2023	7
YDP-WA138	「WA150-8」	2022- 2023	4
EDR-WA105	「WA200-6」	2007	1
YDR-WA137	「WA200-8」	2023	1
TOTAL			17