

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic Vehicles

CAMPAIGN No.	5789	DATE	March. 19. 2026
MANUFACTURER	HONDA MOTOR CO., LTD.		
DESCRIPTION OF DEFECT	<p>In the engine, due to improper designs of the piston and the top ring, the gap between them is excessively wide. As a result, when the engine repeatedly decelerates using engine braking from high RPM, engine oil may sometimes be drawn into the combustion chamber and burned, leading to increased oil consumption. For this reason, abnormal noise may occur due to the oil's insufficient lubrication. If the vehicle continues to be operated without corrective action, the engine may fail while the vehicle is running, which can cause the rear wheel to lock and potentially lead to a tip-over or fire.</p>		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
8BL-SC94	「CB1000F」 「CB1000F SE」	2025	1,341
8BL-SC86	「CB1000 HORNET」 「CB1000 HORNET SP」	2024~2025	620
TOTAL			1,961