

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / ~~Import Vehicles~~

CAMPAIGN No.	5816	DATE	May 14, 2026
MANUFACTURER	UD Trucks Corporation		
DESCRIPTION OF DEFECT	With regard to variable oil pumps, due to insufficient durability verification of the variable stator material, repeated oil pressure control according to operating conditions may cause damage and wear to the stator sliding surface of the housing cover. Thus, if the vehicle continues to be operated under these conditions, proper oil pressure may not be maintained, and a warning message indicating low engine oil pressure may be displayed on the instrument cluster and a warning lamp may be activated along with engine power limitations. Furthermore, if the vehicle continues to be operated under these conditions, the engine may seize and the vehicle may become inoperable.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLES
2PG-GK6DAB	Quon	2023-2025	177
2PG-GK6DAD		2023-2025	111
2KG-GW6DAH 2PG-GW6DAH		2023-2025	22
2DG-GW6EAH		2023-2025	324
2DG-GW6ELH 2DG-GW6ELHKai		2023-2025	560
2PG-EK6DAB		Giga	2023-2025
2PG-EK6DAD	2023-2025		44
2PG-EW6DAH	2023-2025		29
2DG-EW6EAH	2023-2025		62
2DG-EW6ELH	2023-2025		278
			TOTAL