

VEHICLE SAFETY / POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN NO.	5846	DATE	July 9 ,2026
MANUFACTURER	ISUZU MOTORS LIMITED		
DESCRIPTION OF DEFECT	Regarding the joint that connects the power steering pump and the oil hose, due to an improper manufacturing process, the washer at the joint has an oversized inner diameter on some vehicles. As a result, if the vehicle continues to be operated in this condition without repair, the O-ring at the joint may be forced by hydraulic pressure into the clearance at the washer inner diameter and may be damaged, which may allow power steering oil to leak. In the worst case, steering effort may increase.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2KG-FVR26U4□ 2PG-FVR26U4	[FORWARD]	2024-2026	55
2DG-FVZ26U4□ 2WG-FVZ26U4		2024-2026	364
2KG-BVR26U4□ 2PG-BVR26U4	[CONDOR]	2024-2025	13
2DG-BVZ26U4□ 2WG-BVZ26U4		2024-2026	50
		TOTAL	482

The Affected Parts Shipped As Repair Parts, But The Vehicles With Them Installed, Cannot Be Identified.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF □ VEHICLE
Joint	7-55221623-0	2025-2026	23
		TOTAL	23