

VEHICLE SAFETY/POLLUTION RECALL CAMPAIGN IN JAPAN

Domestic / Import Vehicles

CAMPAIGN No.	5861	DATE	Aug. 3. 2026
MANUFACTURER	Hino Motors, Ltd.		
DESCRIPTION OF DEFECT	On certain fuel piping for the supply pump, strength against vibration is insufficient due to inadequate design analysis. Therefore, if fuel components undergo a phase change at low temperatures and clog the fuel filter, the suction negative pressure generated by the supply pump increases, leading to greater fuel pressure fluctuations, which would allow the piping to have resonance exceeding design limits, potentially causing cracks and resulting in fuel leakage.		

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2KG-FC2ABA	[HINO Ranger]	2024～2025	2, 197
2KG-FC2ABG			
2PG-FC2ABA			
2PG-FC2ABG			
2DG-FD2ABA		2024～2025	5, 409
2KG-FD2ABA			
2KG-FD2ABG			
2KG-FD2ABJ			
2PG-FD2ABA			
2PG-FD2ABG			
2PG-FD2ABJ			
2DG-FE2ACA		2024～2025	2, 206
2KG-FE2ACA			
2KG-FE2ACG			
2PG-FE2ACA			
2PG-FE2ACG			
2DG-FG2ABA		2024～2025	45
2KG-FG2ABA			
2PG-FG2ABA			
2DG-FJ2ACA		2024～2025	577
2KG-FJ2ACA			
2KG-FJ2ACG			
2PG-FJ2ACA			
2KG-FX2ABA		2024～2025	99
2KG-GC2ABA			
2KG-GC2ABG		2024～2025	514

TYPE	COMMERCIAL NAME	MODEL YEAR RECALLED	NUMBER OF VEHICLE
2DG-GD2ABA	[HINO Ranger]	2024～2025	807
2KG-GD2ABA			
2KG-GD2ABG			
2DG-GK2ABA		2024～2025	730
2KG-GX2ABA		2024～2025	355
2PG-GX2ABA			
2DG-RR2AJDA	[HINO Melpha]	2024～2025	320
2DG-RU2AHDA	[HINO Selega]	2024～2025	146
2SG-HL2ANBP	[HINO Blue Ribbon Hybrid]	2024～2024	66
		TOTAL	13,471

The affected parts shipped as repair parts, but the vehicles with them installed, cannot be identified.

PARTS NAME	PARTS NO.	SHIPMENT YEAR	NUMBER OF PARTS
Fuel Filter Element	23304EV640	2024～2026	5,459
Fuel Filter Assembly	23330E0263	2024～2026	396
	23330E0193	2024～2025	3
		TOTAL	5,858